

Date: Tuesday, 5/9/2006 9:17:28 AM  
 User: Linda Lacelle

## Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: CABLE GUARD
Job Number	: 27043		
Estimate Number	: 12410		
P.O. Number	: N/A	Part Number	: D34993
This Issue	: 5/9/2006 S.O. No. : N/A	Drawing Number	: D3499 REV A
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: N/A Type : MACHINED PARTS	Drawing Revision	: A
Previous Run	: N/A	Material	: N/A
Written By	: <u>SEE COMMENT BELOW</u>	Due Date	: 5/16/2006
Checked & Approved By	: <u>SEE ABOVE USER &amp; DATE</u>	Qty:	10 Um: Each
Comment	: Est Rev:A New Issue 06-05-05 JLM		

## Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	WATER JET	FLOW WATER JET
-----	-----------	----------------



Comment: FLOW WATER JET

1-Cut as per Dwg D3499

Dwg Rev: A

Prog Rev: A

2-Deburr if necessary

MUHMMBIO 8100417



06-05-10 (10) ~~10~~

2.0	QC2	INSPECT PARTS AS THEY COME OFF MACHINE
-----	-----	--



Comment: INSPECT PARTS AS THEY COME OFF MACHINE



06/05/10 9

3.0	HAAS1	HAAS CNC VERTICAL MACHINING #1
-----	-------	--------------------------------



Comment:

HAAS CNC VERTICAL MACHINING #1

1- Mill as per Folio FA636 Rev: AA &amp; Dwg D3499 Rev: A

2-Deburr per dwg D3499

06/05/09 7 P10

4.0	QC2	INSPECT PARTS AS THEY COME OFF MACHINE
-----	-----	--


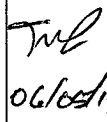
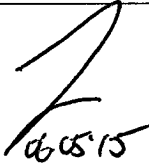

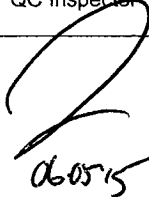

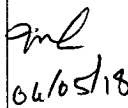
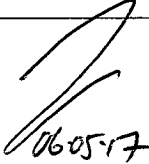

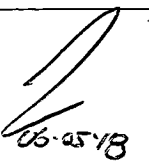


Comment: INSPECT PARTS AS THEY COME OFF MACHINE



06/05/09 7

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			
06.05.10	1.0	1 Scrap moved on machine, 1 cut too short, hole too close to edge.		2 Scrap is use Mat'l for tooling is identify.	 06/05/15	 06.05.15	 06.05.18 PCV QSI DTL	 06.05.15
06.05.18	3.0	1 part all tolerances off by .050. in width & hole location. off on set-up.		Scrap: destroy	 06/05/18	 06.05.17	 06.05.18 PCV QSI DTL	 06.05.18

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☐ No ☒ DQA:  Date: 06/05/23

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Date: Tuesday, 5/9/2006 9:17:29 AM  
User: Linda Lacelle

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: CABLE GUARD

Job Number: 27043

Part Number: D34993

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC8

SECOND CHECK



*06-05-18*

⑦

Comment: SECOND CHECK

6.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: *GA*

*SB 06/05/23*

⑦

7.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

Job Completion



*U 06-05-23*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_



NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_




DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	<b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. <b>D3499</b>	REV. A SHEET 3 OF 4
DATE <b>06.04.11</b>		TITLE <b>CABLE GUARD</b>	SCALE 1:4

RELEASED  
06.05.03 *[Signature]*

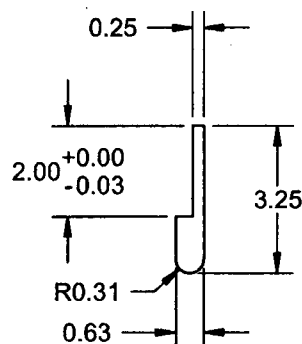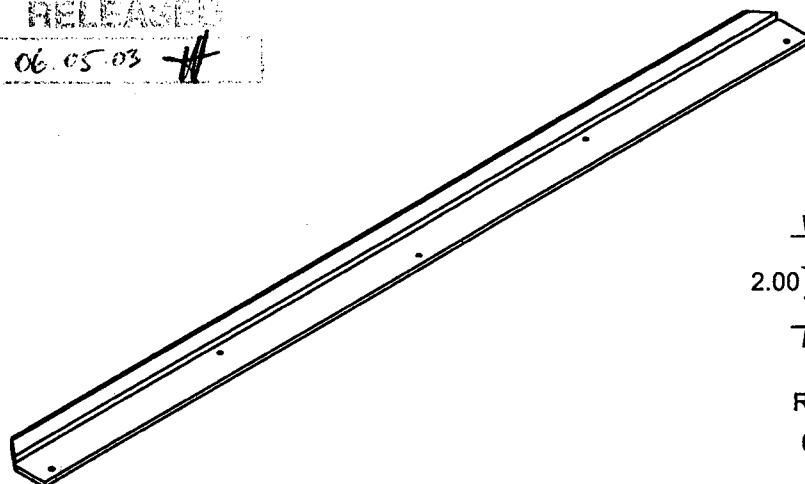

**VIEW B-B**

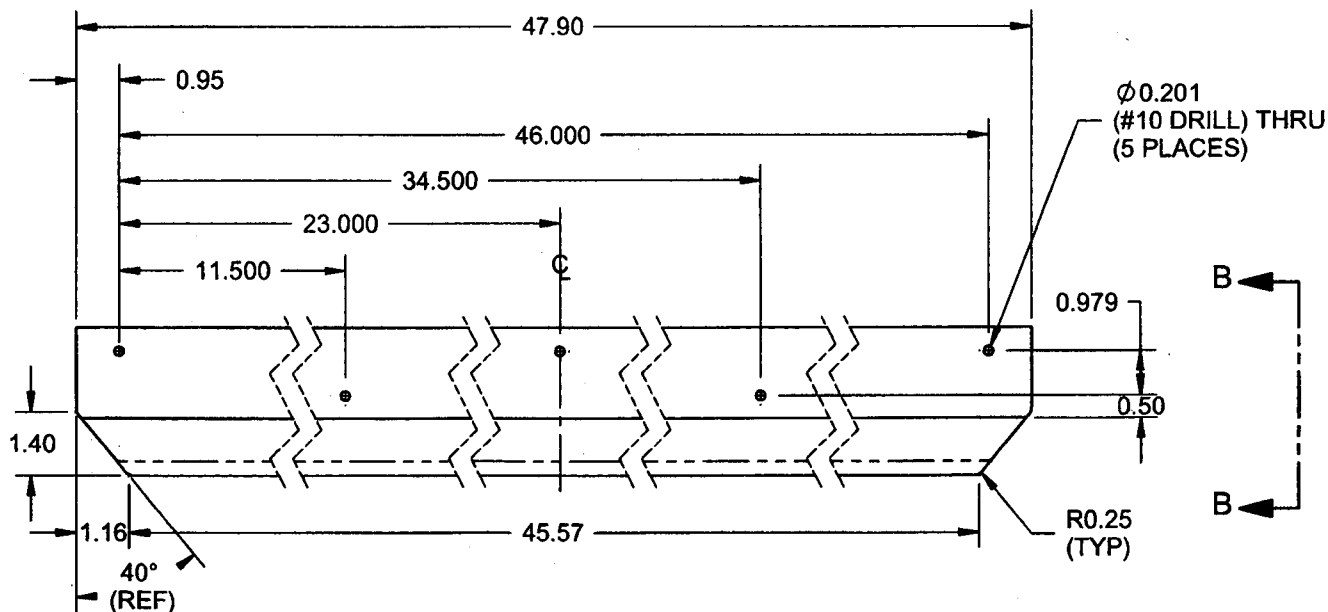

**D3499-3 CABLE GUARD**

**NOTES:**

- 1) MATERIAL: UHMW BLACK TIVAR 1000 VIRGIN MATERIAL (MUHMWB)
- 2) PART IS SYMMETRICAL AT CENTER LINE
- 3) FINISH: NONE
- 4) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 5) ALL DIMENSIONS ARE IN INCHES
- 6) BREAK ALL SHARP EDGES 0.005 TO 0.010

**COPYRIGHT © 2006 BY DART AEROSPACE USA, LTD.**

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

